APP CRS	Rwy ldg	4011
095°	TDZE	663
	Apt Elev	663

RNAV (GPS) RWY 9
FREMONT (14G)

DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. Use Sandusky County Rgnl altimeter setting; when not received use Toledo Excutive altimeter setting and increase all MDA 40 feet and LNAV Cat D visibility ¼ mile.

MISSED APPROACH: Climbing right turn to 2600 direct KADBY and hold.

TOLEDO APP CON	UNICOM
126.1 307.0	122.8 (CTAF) L

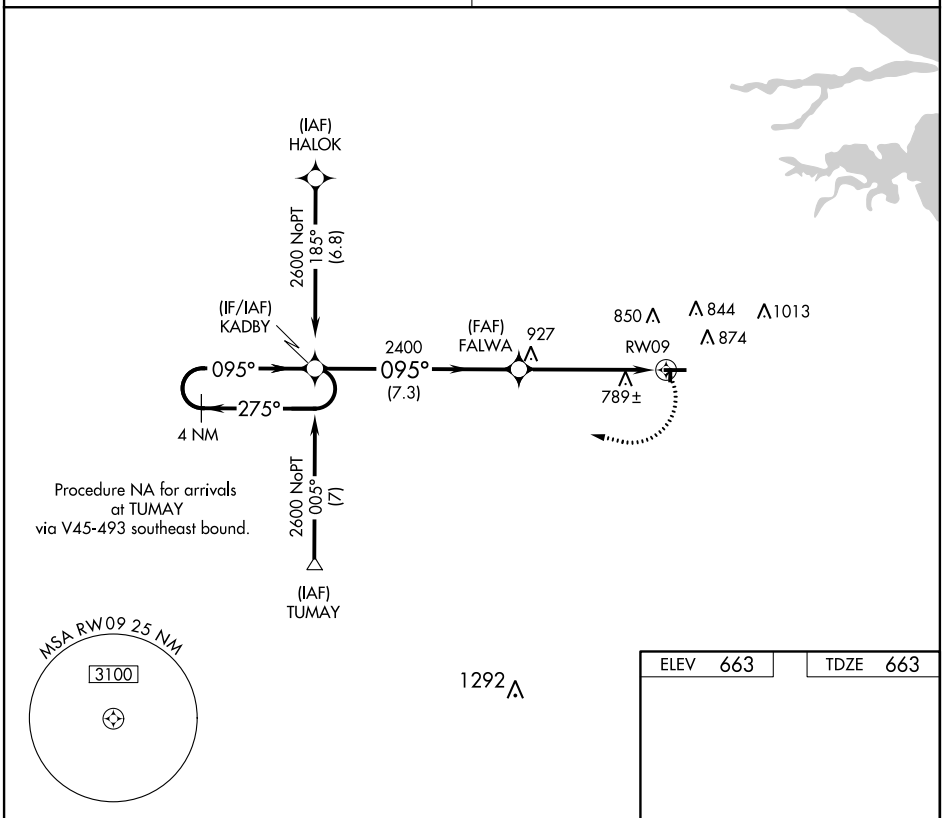

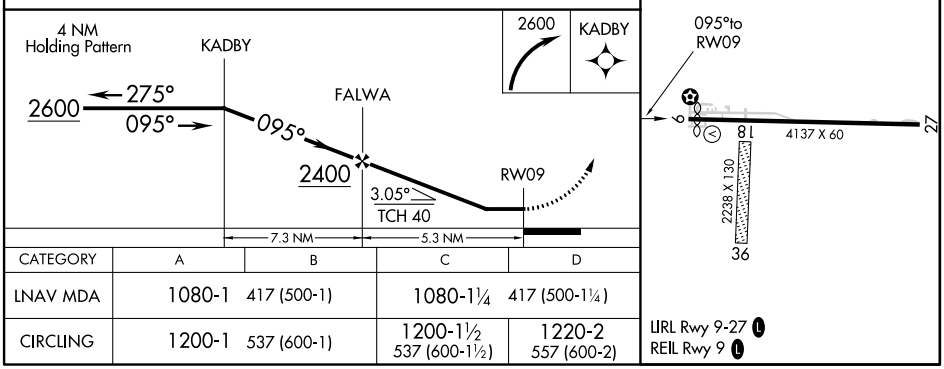

CATEGORY	A	B	C	D
LNAV MDA	1080-1 417 (500-1)		1080-1¼ 417 (500-1¼)	
CIRCLING	1200-1 537 (600-1)		1200-1½ 537 (600-1½)	1220-2 557 (600-2)

EC-2, 17 SEP 2015 to 15 OCT 2015
EC-2, 17 SEP 2015 to 15 OCT 2015

VOR RWY 9
FREMONT (14G)

VOR/DME VWV 113.1 Chan 78	APP CRS 110°	Rwy ldg 4011 TDZE 663 Apt Elev 663

ADF or DME required. Use Sandusky County Rgnl altimeter setting; when not received, use Toledo Executive altimeter setting and increase all MDA 40 feet, increase S-9 Cats C and D and Circling Cat C visibility ¼ mile.

NA

MISSED APPROACH: Climbing right turn to 2300 via VWV VOR/DME R-110 to HELIO Int/VWV 17 DME and hold.

TOLEDO APP CON	UNICOM
126.1 307.0	122.8 (CTAF) L

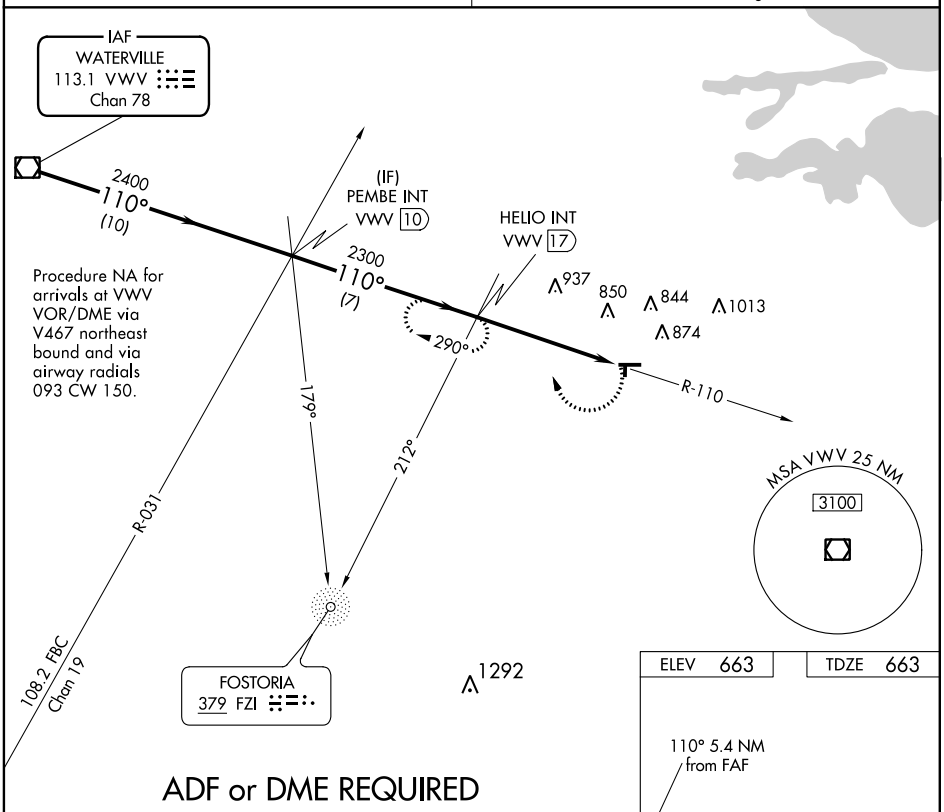

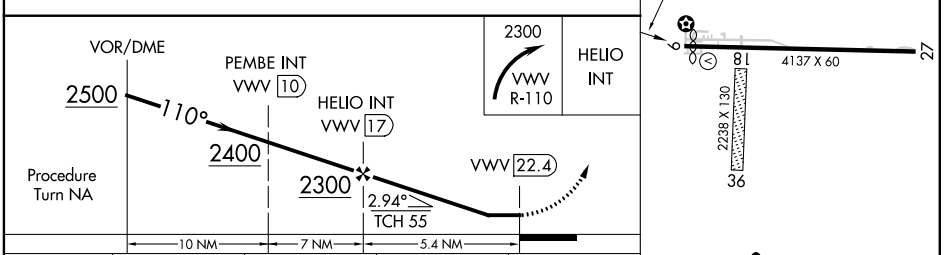

ELEV 663	TDZE 663

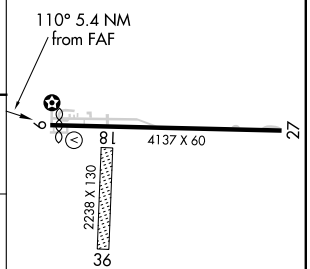

LIRL Rwy 9-27 L
REIL Rwy 9 L

CATEGORY	A	B	C	D
S-9	1260-1 597 (600-1)	1260-1¼ 597 (600-1¼)	1260-1½ 597 (600-1½)	1260-1¾ 597 (600-1¾)
CIRCLING	1260-1 597 (600-1)	1260-1¼ 597 (600-1¼)	1260-1½ 597 (600-1½)	1260-2 597 (600-2)

FAF to MAP 5.4 NM

Knots	60	90	120	150	180
Min:Sec	5:24	3:36	2:42	2:10	1:48

EC-2, 17 SEP 2015 to 15 OCT 2015

EC-2, 17 SEP 2015 to 15 OCT 2015