TACAN RWY 28R
NIAGARA FALLS INTL (IAG)

TACAN IAG Chan 47	APP CRS 286°	Rwy ldg 9129 THRE 588 Apt Elev 592

When local altimeter setting not received, use Buffalo Niagara Intl altimeter setting and increase all MDA 60 feet; increase S-28R visibility for Cat C/D/E to RVR 4500 and Circling Cat D/E visibility ¼ mile. Circling NA for Cat E south of Rwy 10L-28R. For inop MALSR, increase S-28R Cat A/B visibility to RVR 5000 and Cat C/D/E to RVR 6000. Circling to Rwy 6/24/10R/28L NA at night. Helicopter visibility reduction below ¾ SM NA.

MALSR

MISSED APPROACH: Climbing right turn to 3000 on heading 100° and IAG R-084 to EDUSE/IAG 15 DME and hold.

ATIS	BUFFALO APP CON	NIAGARA TOWER★	GND CON	CLNC DEL	UNICOM
120.8 269.4	126.5 317.6	118.5 (CTAF) L 349.0	121.7 275.8	119.25 251.1	122.95

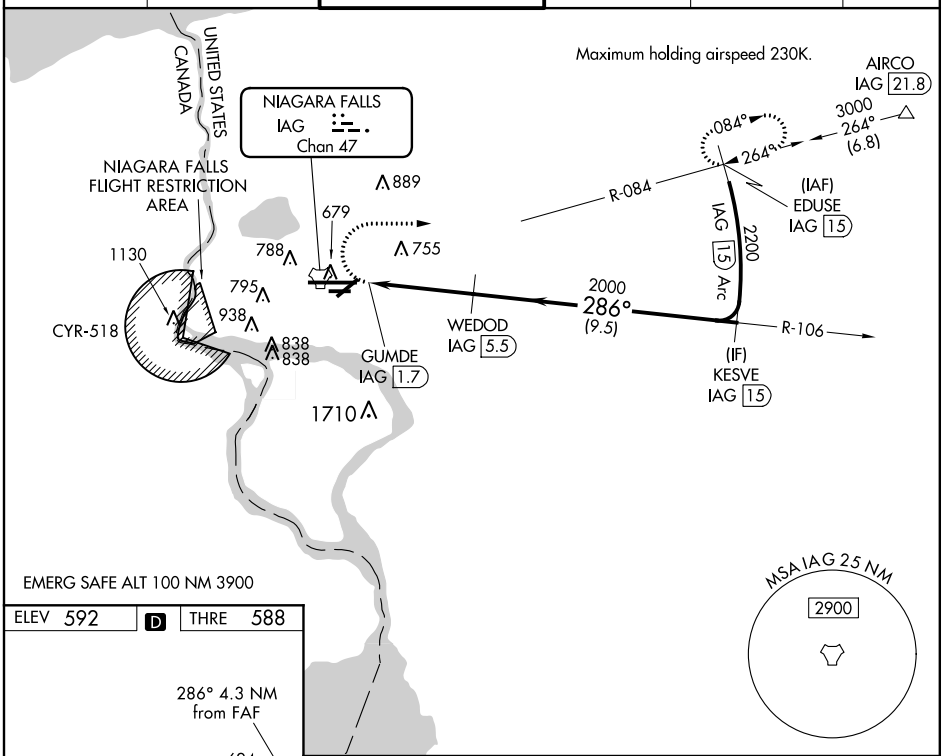

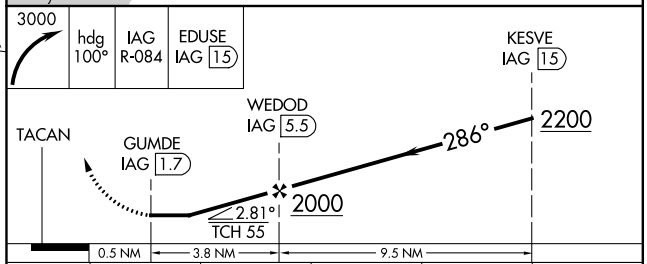

TDZ/CL Rwy 28R
REIL Rwys 6,10R, 24, and 28L L
HIRL Rwy 10L-28R L
MIRL Rwys 6-24 and 10R-28L L

CATEGORY	A	B	C	D	E
S-28R	1000/40 412 (500-¾)				
CIRCLING	1100-1 508 (600-1)		1100-1½ 508 (600-1½)	1360-2½ 768 (800-2½)	1360-2¾ 768 (800-2¾)

NE-2, 18 SEP 2014 to 16 OCT 2014
NE-2, 18 SEP 2014 to 16 OCT 2014