
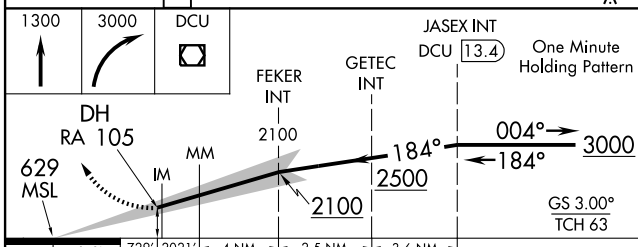
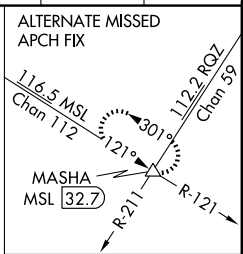


LOC I-HSV 109.3	APP CRS 184°	Rwy ldg 12600 TDZE 629 Apt Elev 629
---------------------------	------------------------	--


ILS RWY 18R (CAT II)

HUNTSVILLE INTL-CARL T. JONES FIELD (HSV)

<p>Cat II minimums NA when control tower closed. Simultaneous approach authorized with Rwy 18L.</p>	ALSIF-2		MISSED APPROACH: Climb to 1300 then climbing right turn to 3000 direct DCU VOR/DME and hold.		
	ATIS 121.25	HUNTSVILLE APP CON * 125.6 354.1	HUNTSVILLE TOWER * 127.6 (CTAF) 350.35	GND CON 121.9 269.525	CLNC DEL 120.35

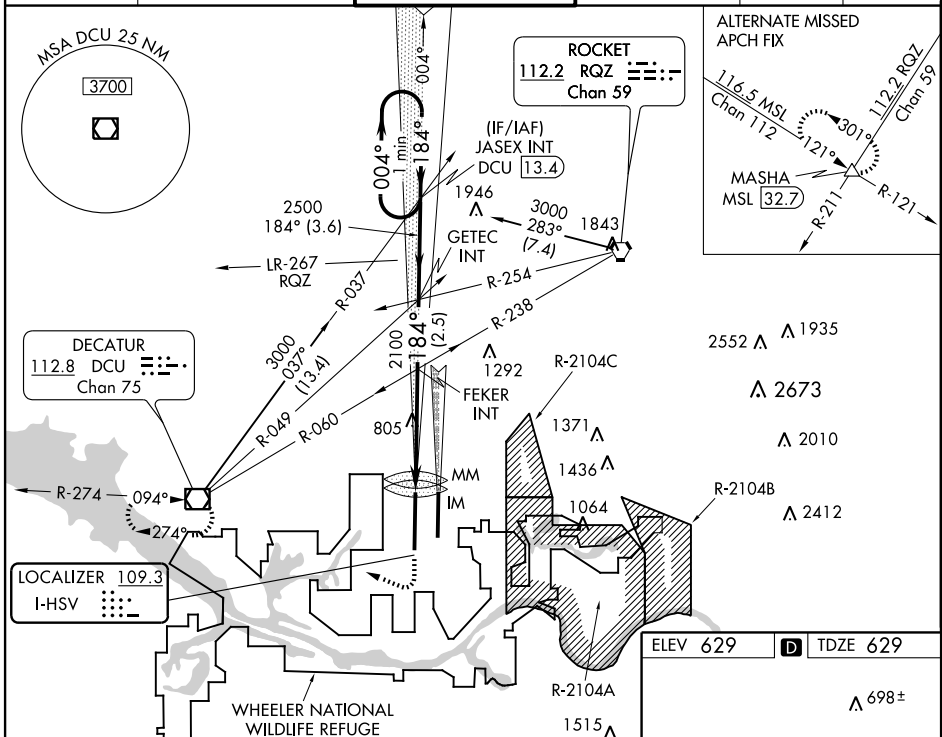

ELEV 629	TDZE 629
----------	----------

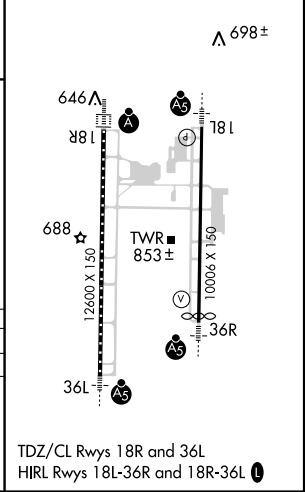

1079'	729'	2021'	4 NM	2.5 NM	3.6 NM
CATEGORY	A	B	C	D	
S-ILS 18R	RA 105/12 100 DA 729				

CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

TDZ/CL Rwy 18R and 36L
HIRL Rwy 18L-36R and 18R-36L

SE-4, 31 MAY 2012 to 28 JUN 2012

SE-4, 31 MAY 2012 to 28 JUN 2012